

LAND CORNER RECORD

Index: G-15	Corner: C1/4	State of Indiana - Hoosier National Forest		
Section: 10	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1387384.950	Long./E: 3147794.280	Datum: NAD83 IN West Zone, US Survey Feet	


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
5/17/1983	Ken Anderson L.S. #80040545	A stamped 3" aluminum monument set	USDA Forest Service Bedford, IN	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
Record evidence of prior survey:	Ken Anderson set this monument in 1983 on an unrecorded survey.			
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
1/21/2009	Kevin Enright Monroe County Surveyor	A 3/4" iron pipe found	Monroe County Surveyor's Office Bk. 42, Pg 15	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Beech	15"	S65°E	17.88'
	Black Oak	18"	N55°W	6.45'
	Brass Disc in Conc.	4"	S32°W	N/A
Record evidence of prior survey:	This Monument Record was never approved and Enright had referenced the wrong monument.			

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Shagbark Hickory	12"	S25°E	23.88'
	Sassafras	10"	N40°E	18.65'
	Monument (F15-.96)	N/A	N00°E	41.94'
Monument Found or Set:	A 3" aluminum monument stamped "T7N R1E S.10 C1/4 1983" found 0.2' above grade.			


MONUMENT SKETCH

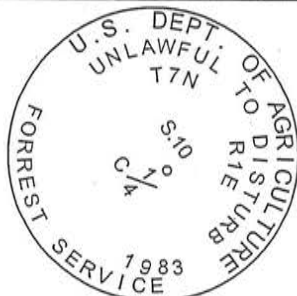

NARRATIVE REFERENCE:

Monument is a 3" aluminum monument stamped "T7N R1E S.10 C1/4 1983" found 0.2' above grade, a carsonite post is located 2.0' north of the monument, +/- 40' and 100' south of two old road beds running east-west with a ridge, on a steep slope, +/- 150' north of a small creek that is emptying into Lake Monroe, surrounded by mature forest, 25' south of a road bank, a rock cairn at the base of the monument.

SECTION DIAGRAM

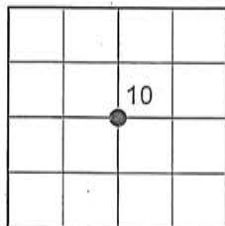

Corner Location = ●

PERPETUATION RECORD:

The record monument was found undisturbed and maintained by establishing two new bearing trees and one new reference object.

Two new bearing trees were marked with a bearing tree sign, paint, and mag nail.

*Referenced on BRCJ survey recorded as InstNo.2018011507
Accepted by the Monroe County Surveyor Review Board on August 6, 2019.*

Section: 10 T7N R1E

Prepared By: BRCJ (Project#3-0823) Date: 5/2018